

# tempmate.<sup>®</sup>-M2


## OPERATION INSTRUCTIONS

 Start Button


 Stop Button

 Green LED


 Red LED

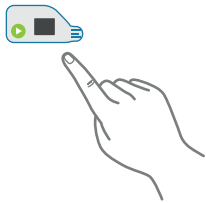

01 Keep green button pressed for minimum 5 seconds to start recording

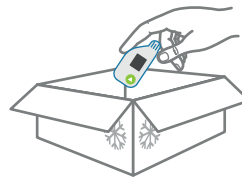

02 Add started tempmate.<sup>®</sup>-M2 to your shipment

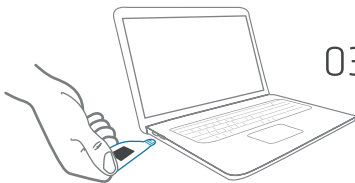

03 Connect stopped logger directly to USB port



04 The PDF report will be generated automatically

 LED Indication  
 Display Indication

  
5 sec.

Start Logger  
Stop Logger

**Rec.**   
**Stop** 

  
1 time

Not started  
Low battery  
Recording-OK  
Recording-Alarm

  
3 sec. 

**Rec.** 

**Rec.** 

  
2 times

Set Mark  
Mark limit full

**Mark**   
**Mark** 

Stopped-OK

Stopped-Alarm

**Stop** 

**Stop** 



For further information visit [www.tempmate.com/M2](http://www.tempmate.com/M2)