


OPERATION INSTRUCTIONS


 Start Button

 Green LED


 Red LED

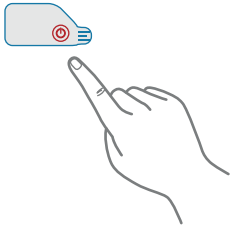


01 Keep button pressed for minimum 5 seconds to start recording

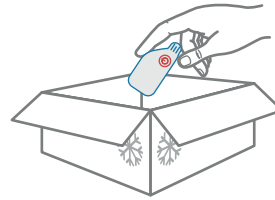

02 Add started **tempmate®-S1 PRO** to your shipment

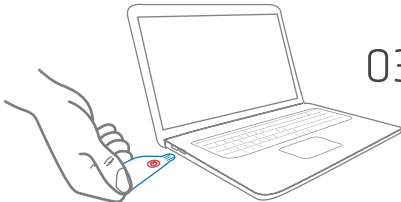

03 Connect stopped logger directly to USB port

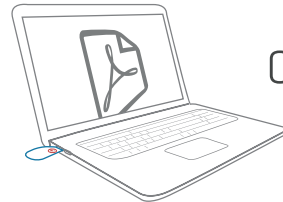

04 The PDF report will be generated automatically

 LED Indication



5 sec.

Start Logger
Stop Logger

Rec.




Stop



1 time

Not started
Low battery



3 sec. 

Recording-OK
Recording-Alarm



Stopped-OK
Stopped-Alarm



Delay Start



2 times

Set Mark
Mark limit full

Mark



Mark



For further information visit www.tempmate.com